

LIGHT BAR. KW T680, T880, W990,

INSTALLATION INSTRUCTIONS:

1. Cut out the provided drill template(s) and secure in place within some tape on the respective side of the Upper Cowl panel.
2. Using a 1/8" (or smaller) drill bit, drill hole location center point cross hairs. Eight (8) holes for mounting light bar and one (1) hole for wiring.
3. Remove Upper Cowl panel(s) and place on a flat workspace surface.
4. With a 7/32" drill bit (0.218" Ø) or slightly larger diameter (1/4") which will allow some room for adjustment, drill the 8 mounting locations followed by a 1" hole saw for the wiring.
5. Peel plastic from the mounting flanges that will contact the Upper Cowl surface.
6. Route wiring through hole and attach light bar using supplied washers and fasteners to the Upper Cowl panel. NOTE: Thread lock (BLUE) is recommended for fasteners but not included.
7. Re-install Upper Cowl panel ensuring the wiring will not be pinched upon tightening fasteners.
8. Connect wiring to a fused 12v source of power and peel protective plastic from light bar.
9. Clean with glass cleaner and soft cloth if necessary.